

Aug-2023 Update RT11-E-2

A COMPLETELY BALANCED DRILLING SYSTEM FOR OVERBURDEN DRILLING

SUPER MAXBIT

The SUPER MAXBIT gives stability when drilling collapsing overburden formations.



SUPER MAXBIT


The SUPER MAXBIT gives stability when drilling collapsing overburden formations.

This is an advanced technology compared to the other eccentric drilling methods. It consists of two to three wings connected to the Down The Hole Hammer. The bit wings can be opened/retracted in forward/backward rotation. Drilling and casing installation are possible simultaneously with the use of a casing shoe.


The SUPER MAXBIT has a following advantages:

- High-speed drilling similar to a standard DTH bit.
- Straight hole drilling.
- Uniform rotation while drilling of boulders, sand and gravel.
- Reliability of extending and retracting proven by customer experiences.

MECHANISM

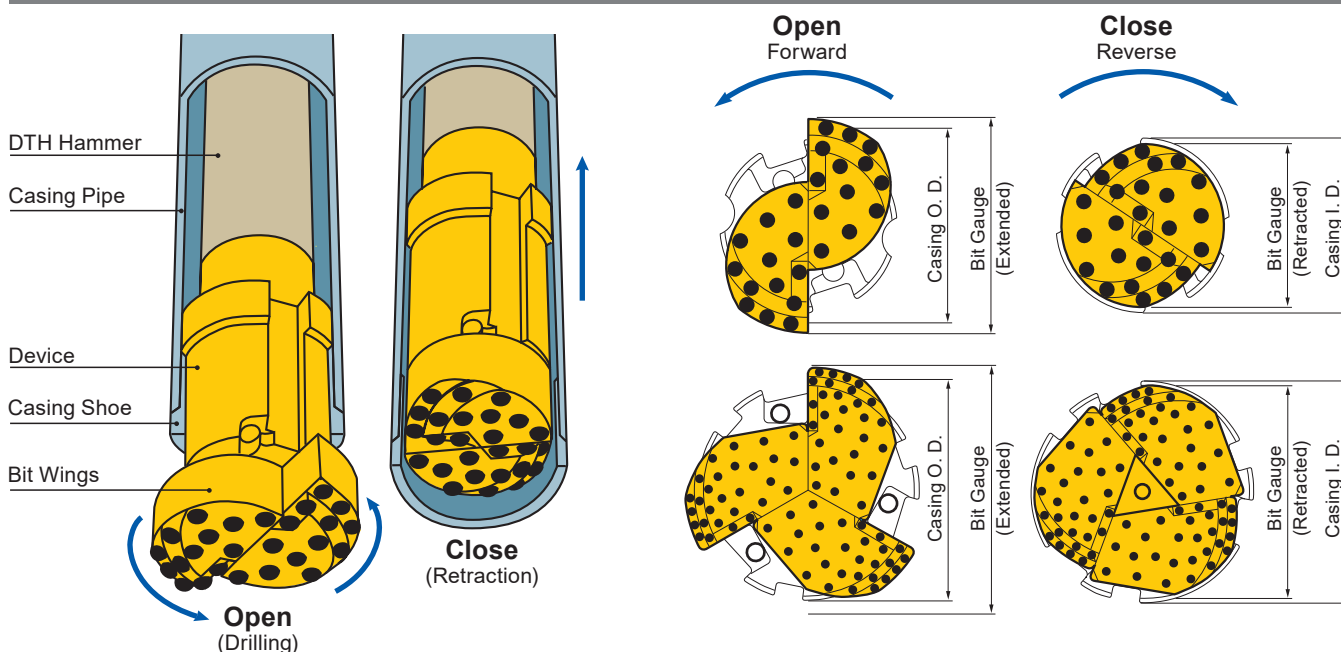

COMPONENTS

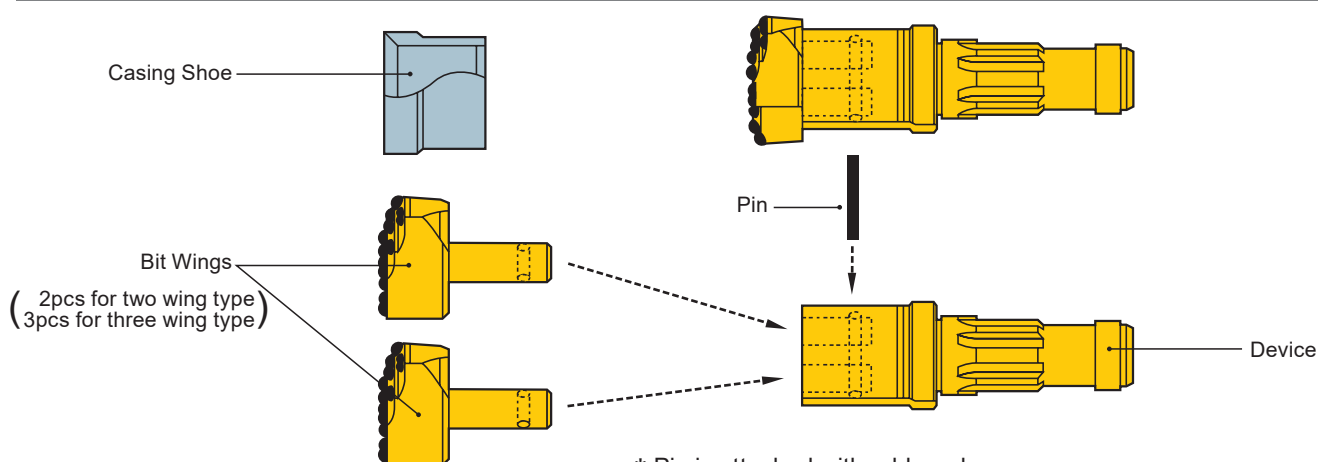


- * Pin is attached with rubber plug.
- * Retainer ring and rubber plug are not attached under 4" bit.
- * Please be careful not to get your finger snapped when assembling.

OTHERS

Rotation Speed of Bit

Target external rotation speed to 15-20m/min.
Refer to the following figure for rotation.
Select the range of uniform rotation during drilling.

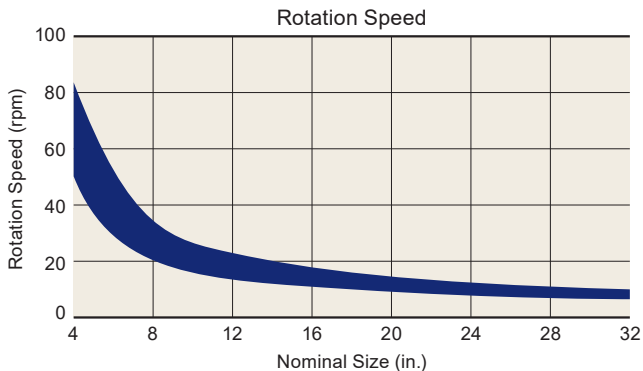

Setting Compressor

- Pressure
 - Set between 0.7 to 1.0MPa (100-150psi)
 - Consider the depth of underground water when drilling through the layer.
(In case of 30m (90ft) depth, add 0.3MPa (45psi) to the air pressure.)
 - Do not set over 1.5MPa (225psi)

- Air Consumption
 - Set the air supply using the following formula.

$$Q = \frac{V(D^2 - d^2)}{1273500}$$

Q : Air supply (m³/min)

D : Inside diameter of casing (mm)

d : Outside diameter of jacket or hammer (mm)



V : Air speed 1,100-1,500 (m/min)

Recommended Air Consumption


Nominal Size (in.)	Air Supply	
	(m ³ /min)	(cfm)
4	4-15	140-530
8	19-26	670-920
12	33-45	1,170-1,590
16	42-57	1,480-2,010
20	59-80	2,080-2,830
24	72-98	2,540-3,460
28	81-111	2,860-3,920
32	90-122	3,180-4,310

Exchange of components is necessary

- Wings
 1. When the wear detection mark on a wing disappears.
 2. When the carbide wear is excessive.
 3. When wing body wears and carbides pop out.

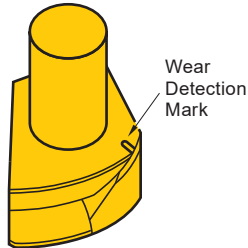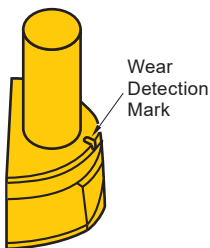

- Device
 - When the wear detection marks on the device end disappear.

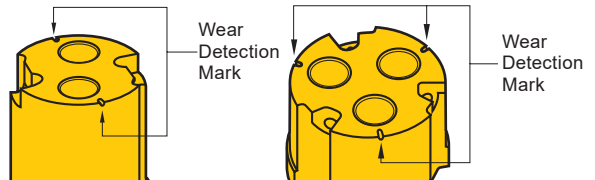

- Pin
 - When the wear attains the following value.
Please exchange the pin if you observe excessive wear.

	Two Wing Type	Three Wing Type
Amount of Wear (mm)	0.5-1.0	0.5-1.0
Geometry		

APPLICATIONS

The SUPER MAXBIT is designed for drilling in gravel, clay, sand mixture, boulders and easy collapsing overburden.
The system is applicable for the various intentions with the combination of appropriate rig and drill.



Water Well
Drilling water wells down to 50-250m in depth.



Piling
After casing through the collapsing overburden, insert a H-steel, then pull up the casing.




Pipe Roof, Water Service Water Remove, Anchoring
It achieves excellent results for drilling of long holes and hard formations using the Down The Hole Hammer.
Top-Hammer applications are available.



Foundation
Foundational construction of buildings and bridges up to 32"(ø800) of casing diameter.





Geothermal, Oil Well
Surface drilling down to 50m in depth for geothermal and oil well.

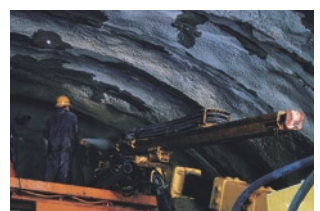


Fore Piling
For piling as a reinforced method of tunneling in collapsing overburden.

TROUBLE SHOOTING

Trouble	Reason	Solution
Less hammering.	Air pressure is too low to work. (The hole is too deep that causes shortage of air pressure)	Compressor should be replaced with a bigger one, or install one more compressor and air receiver tank.
	Just drilling through clay formation. Drive sub is loosen.(in the thread)	The frequent hole cleaning is necessary. Rotate in forward direction may screw down. Pull up casing pipe and screw down, the drill strings with the driver sub properly.
	Sand or clay infiltrating into the hammer. Cutting are remaining between driver sub and bit wing.	Wipe off sand or clay inside the hammer. Flushing out cuttings enough.
	Cutting are sticking in bit blow hole.	Flushing frequently.
The bit does not rotate at all.	Drilling through fractured zone.	The bit should be operated with lower feed pressure.
	Hit a scrap iron.	Pull up the drill strings, and remove a scrap iron by casing a rotary bit. After that,start drilling with SUPER MAXBIT.
	The bottom of the hole is filled with cuttings.	Water inside the casing pipe, and cuttings should be flushed out easily.
	Machine torque is too low. Sticking through cave zone.	Machine should be replaced with a bigger one. Pull up the drill strings and casing pipe about 20-30cm, then screw down slowly with hammering.
Cutting are not flushed out of the hole well.	Less air compresor or air volume.	Compresor should be repraced with a bigger one or install one more compresor and air receiver tank.
	Just drillings through clay formation.	The frequent hole cleaning is necessary.
	Cutting are staying inside the casing pipe.	Water inside the casing pipe and cutting should be flushed out easily.
	Drilling through cracky formation that leaks out air so much. Air leaking from slited casing pipe.	Water inside the casing pipe and cutting should be flushed out easily. Before drilling, plugging up the slit of casing pipe by using tape.
Casing pipes are not driven down.	Breakage of the weld joint.	Weld carefully so that the weld on the inside of the casing pipe. Check the casing pipe is vertical and is linear. Check that each weld is straigh and smooth so that the friction between the casing pipe and hole wall is minimam.
	Breakage of the thread joint.	Never use threaded joint casing pipe in deep hole. (more than 20m)
Breakage of the pin.	Knocking on the side pin by hammering while the bit is not on the bottom.	Keep the bit wings on the bottom of the hole.
	Hammering in sand formation.	Feed and air pressure must be carefully watched to keep the face at the bit wing.
The bit wings does not open.	The bit wings is not on the bottom of the hole.	Keep the bit wings on the bottom with higher feed pressure.
	Clay or mud has instruded into the hole of the device.	Clean the holes of the device.
	Ground condition is too sticky to open.	Pull up the bit, (you should throw some small gravel.) and put small amount of gravel into the hole to get some friction which is needed for extension.
The bit wings does not close.	The bit wings is not on the bottom of the hole.	Keep the bit wings on the bottom with higher feed pressure.
	Cutting are sticking around the bit wings so much.	Flushing out cutting enough.
The drill strings can not be pulled out.	The thickness of the weld inside of the casing pipes exceeds limitation. (>0.5mm=1/64")	Pull up the drill strings slowly with forward slow rotation carefully. Please do not hurry to pull up, because the overweld of casing tubes can be ground off by the device shoulder. So it may take a long time to do so.
	There is a concave on the outside of the casing pipes which has broken during drilling.	In water well drilling, sometimes rock or gravel will be pushed into slots of straner that will cause a concave on the casing pipes. So carefull operations are necessary.

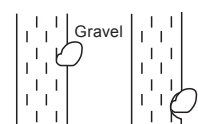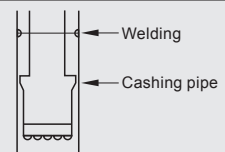

APPROPRIATE CASING AND HAMMER SIZE

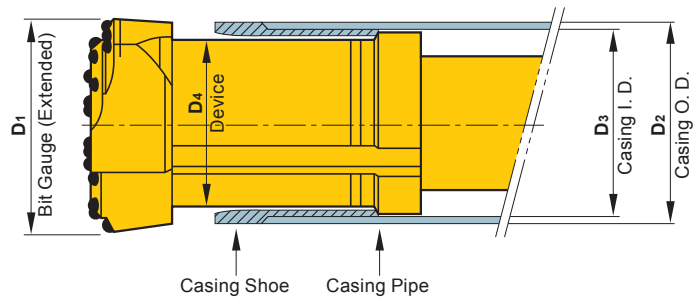

Type	Two Wing	Three Wing	Bit Gauge				Applicable Casing Pipe			Device O. D. D ₄	Hammer Size	*	1	2	3	4	5
			Extended D ₁		Retracted		Max. O.D. D ₂	Min. I.D. D ₃	Nominal Size								
			mm	in.	mm	in.	mm	mm	in.	mm	in.						
90	●		125	4.92	91	3.58	114.3	102.3	4"	92	3"						
115	●		152	5.98	114	4.49	141.3	126.6	5"	115	4"						
140	●		185	7.28	140	5.51	165.2	153.2	6"	141	5"						
165	●		215	8.46	166	6.54	190.7	178.7	7"	167	6"						
187	●		237	9.33	186	7.32	216.3	202.3	8"	187	6"						
215	●	●	272	10.71	217	8.54	254.0	241.0	9"	218	8"						
240		●	290	11.42	232	9.13	273.1	254.5	10"	240	8"						
280		●	340	13.39	281	11.06	318.5	301.7	12"	283	10"						
315		●	373	14.69	314	12.36	355.6	336.6	14"	316	12"						
365		●	425	16.73	363	14.29	406.4	387.4	16"	365	12"						
410		●	478	18.82	412	16.22	457.2	435.0	18"	414	15"						
460		●	530	20.87	461	18.15	508.0	482.6	20"	463	15" 18"						
510		●	580	22.83	509	20.04	558.8	533.4	22"	511	15" 18"						
560		●	630	24.80	559	22.01	609.6	584.2	24"	561	18"						
600		●	685	26.97	600	23.62	660.4	631.8	26"	603	20"						

* When ordering, information about casing diameters (O.D. and I.D.) is necessary.
* Order made bits can be manufactured upon request.

*1 : Water Well
*2 : Piling, Foundation
*3 : Pipe Roof, Water Service, Water Remove, Anchoring
*4 : Geothermal, Oil Well
*5 : Fore Piling



MITSUBISHI MATERIALS HARDMETAL CORPORATION

JAPAN / ROCK TOOLS

MITSUBISHI MATERIALS HARDMETAL CORPORATION TOKYO OFFICE

Marunouchi Nijubashi Building 22F, 3-2-3, Marunouchi,
Chiyoda-ku, Tokyo 100-0005
TEL +81-3-5252-3871

E-Mail: rocktool@mmc.co.jp



<https://www.mmhm.co.jp/en/>

Subsidiaries of MITSUBISHI MATERIALS CORPORATION

U.S.A.	MITSUBISHI MATERIALS U.S.A. CORPORATION 105 Corporate Center Dr. Suite A, Mooresville, NC 28117, U.S.A TEL +1-980-312-3150 E-Mail: mmusclt@mmus.com	Australia	MITSUBISHI MATERIALS TRADING CORPORATION PERTH BRANCH 180 Daly Street, Belmont, WA 6104, Australia TEL +61-8-6185-1025 E-Mail: ml-rckdrill@mmtc.co.jp Website: http://www.mmtc.co.jp/au/
Canada	MITSUBISHI MATERIALS U.S.A. CORPORATION Units 15 & 16 Mississauga, Ontario, Canada L5L 5Y7 TEL +1-905-814-0240 E-Mail: mmusclt@mmus.com	South Korea	MITSUBISHI MATERIALS TRADING CORPORATION SEOUL BRANCH #2227, Gwanghwamun Officia Bldg, 92, Semoonan-ro, Jongro-gu, Seoul, Korea TEL +82-2-3474-2331 E-Mail: ml-rckdrill@mmtc.co.jp Website: https://www.mmtc.co.jp/en/
Germany	MITSUBISHI MATERIALS TOOLS EUROPE GMBH Comeniusstr. 2, 40670 Meerbusch, Germany TEL +49-2159-9189-7759 E-Mail: rocktools@mmchg.de	Singapore	MITSUBISHI MATERIALS TRADING CORPORATION SINGAPORE BRANCH 10 Anson Road, #32-09 International Plaza, Singapore 079903 TEL +65-6221-7233 E-Mail: ml-rckdrill@mmtc.co.jp Website: https://www.mmtc.co.jp/en/
Brazil	MITSUBISHI MATERIALS BRASIL LTDA. Rua Cincinato Braga, 340 13º andar, Bela Vista- CEP 01333-010 São Paulo-SP., BRASIL TEL +55-11-3262-5095 E-Mail: mmbr@mmbr.com.br	China	MITSUBISHI MATERIALS (SHANGHAI) CORPORATION 2101 Tower 1, Raffles City, 1133 Changning Road Changning District, Shanghai, 200051, China TEL :+86-(0)21-6289-6333 Inquiry form : http://www.mmc.sh.cn/contact-us/
Mexico	MITSUBISHI MATERIALS MÉXICO, S.A. DE C.V Av. La Canada No.16 Parque Industrial Bernardo Quintana El marques, Queretaro. TEL +52-442-221-6136 +52-442-221-6137 E-Mail: gonzalez@mmcmex.com		